

Application Work Sheet (Pressure)

☐ Quotation

☐ Purchase Order

For better support to the customer, please fill this form out when you request a quotation or place an order. It will help us to provide you the correct solution and minimize a risk which is our goal for the customer.

General Information

Client	_____	Date	_____
Name	_____	End-User	_____
TEL. No.	_____	Project	_____
FAX. No.	_____	Required delivery	_____
Model	_____		
Quantity	_____		

Performance Specifications

Pressure Range _____

Operating Range _____

Measuring Unit ☐ MPa ☐ bar ☐ kPa ☐ mmHg ☐ mmH2O ☐ mbar

Pressure reference ☐ kgf/cm2 ☐ Torr ☐ psi ☐ °C ☐ °F

Output Signal ☐ mV/V ☐ 4 ~ 20 mA ☐ 1 ~ 5 V ☐ 0 ~ 10 V

Power Supply ☐ 24 V DC ☐ 12 V DC

Physical Specifications

Process Connection ☐ PT 1/4" ☐ PT 3/8" ☐ PT 1/2" ☐ G1/4" ☐ G1/2"

☐ PF 1/4" ☐ PF 3/8" ☐ PF 1/2" ☐ NPT1/4" ☐ NPT1/2"

☐ Flush 1/2" ☐ Flush 3/4" ☐ Flush 1"

☐ 40A Flange ☐ 50A Flange ☐ 80A Flange ☐ 100A Flange

☐ Sanitary Diaphragm _____ ☐ Other _____

Electrical Connection ☐ Terminal ☐ DIN 43650 ☐ M12 Connector ☐ Cable(1.5 m)

Local Display Unit ☐ None ☐ LCD ☐ LED

Process Conditions

Process Media _____

Operating Temperature _____

Humidity _____

Vibration _____

Explosion Protection ☐ Required ☐ No required

Weather Protection ☐ Required ☐ No required

Pressure Range Code

CODE	kgf/cm ²	bar	psi	MPa
0001	0~1	0~1	0~15	0~0.1
0003	0~3	0~3	0~45	0~0.3
0005	0~5	0~5	0~70	0~0.5
0006	0~6	0~6	0~90	0~0.6
0010	0~10	0~10	0~150	0~1
0015	0~15	0~15	0~200	0~1.5
0020	0~20	0~20	0~300	0~2
0025	0~25	0~25	0~350	0~2.5
0030	0~30	0~30	0~450	0~3
0035	0~35	0~35	0~500	0~3.5
0050	0~50	0~50	0~700	0~5
0070	0~70	0~70	0~1000	0~7
0100	0~100	0~100	0~1500	0~10
0200	0~200	0~200	0~3000	0~20
0250	0~250	0~250	0~3500	0~25
0300	0~300	0~300	0~4500	0~30
0350	0~350	0~350	0~5000	0~35
0500	0~500	0~500	0~7000	0~50
0700	0~700	0~700	0~10000	0~70
1000	0~1000	0~1000	0~15000	0~100
2000	0~2000	0~2000	0~28000	0~200
V0000	-76~0 cmHg	-1013~0 mbar	-30~0 inHg	-0.1~0
V0001	-76 cmHg~1	-1013 mbar~1	-30 inHg~15	-0.1~0.1
V0002	-76 cmHg~2	-1013 mbar~2	-30 inHg~30	-0.1~0.2
V0003	-76 cmHg~3	-1013 mbar~3	-30 inHg~45	-0.1~0.3
V0004	-76 cmHg~4	-1013 mbar~4	-30 inHg~60	-0.1~0.4
V0006	-76 cmHg~6	-1013 mbar~6	-30 inHg~90	-0.1~0.6
V0010	-76 cmHg~10	-1013 mbar~10	-30 inHg~150	-0.1~1
V0015	-76 cmHg~15	-1013 mbar~15	-30 inHg~200	-0.1~1.5
V0020	-76 cmHg~20	-1013 mbar~20	-30 inHg~300	-0.1~2
L0600	0~600 mmH2O	0~60 mbar	0~0.9	0~0.006
L1000	0~1000 mmH2O	0~100 mbar	0~1.5	0~0.01
L2000	0~2000 mmH2O	0~200 mbar	0~3	0~0.02
L3000	0~3000 mmH2O	0~300 mbar	0~4.5	0~0.03
L4000	0~4000 mmH2O	0~400 mbar	0~5.5	0~0.04
L5000	0~5000 mmH2O	0~500 mbar	0~7	0~0.05
00000	Other Range			

Pressure

Temperature

Level

The Other

Diaphragm Seal

Pressure & Temperature

P201S Series Diaphragm Sealed Pressure Transmitter



Feature

- Stainless steel flush diaphragm seal
- All stainless steel 316 construction
- Piezoresistive pressure sensor
- Measuring range from 0~0.01 to 0~50 MPa
- Shock and vibration resistance
- Excellent long term stability

Applications

The transmitters can be used for pressure measurement in sticky, high viscous and corrosive area

- Foods, beverage(milk) and pharmaceutical industry
- Level measurement and storage tank management
- Concentration plant
- Process and chemical engineering
- Pulp and paper stock measurement
- Chemical and petrochemical industry
- Equipment and machinery for plant, ink, resin

Input

Technology	Piezoresistive silicon pressure sensor
Pressure range	0 ~ 0.01 to 50 MPa Relative pressure
Pressure reference	Gauge, including vacuum & compound
Overload pressure	1.5 times of F.S

Output

	Current output		Voltage output	
Electrical connection type	2-wire technique		3 or 4-wire technique	
Full scale output signal	20 mA	± 0.1 %	5 V	± 0.1 %
Zero measured output	4 mA	± 0.05 %	1 V	± 0.05 %
Other signals available on request				

Electrical Specifications

Power supply	12 ~ 36 V DC (It is not free voltage)
Load resistance max@24 V	500 Ω at 24 V
Power ripple	≤ 500 mV P-P
Insulation resistor	≥ 20 MΩ, 25 V DC


Performance Specifications

Accuracy	≤ ± 0.5 % F.S.
Non-linearity	± 0.100 % F.S. typical
Repeatability	± 0.05 % F.S. typical
Pressure hysteresis	± 0.05 % F.S. typical
Long term stability	± 0.2 % F.S. over 1 year
Response time(10 % to 90 %)	≤ 20 ms
Reference temperature	25 °C
Working temperature range(Process)	-40 ~ 200 °C
Compensated temperature range(Process)	-10 ~ 80 °C
Ambient temperature range	-10 ~ 60 °C
Thermal sensitivity shift	≤ ± 0.2 % F.S. in reference to 35 °C typical
Thermal zero shift	≤ ± 0.2 % F.S. in reference to 35 °C typical





Physical Specifications

Process connection	Flush Diaphragm
	Other connections available on request
Electrical connection	DIN 43650
Process media	Gases and liquids compatible with STS316, Hastelloy, Nickel & Tantalum
Materials wetted by process	STS 316 L (standard) or Nickel, Monel, Tantalum (Other on request)
	STS 304 (housing – non wetted part)
Enclosure rating	IP65
Influence of mounting position	Not critical
Weight	Approx. 250g + extra (depending on the diaphragm weight)
Option	Remote or Flush Diaphragm Seal



Dimension(mm)

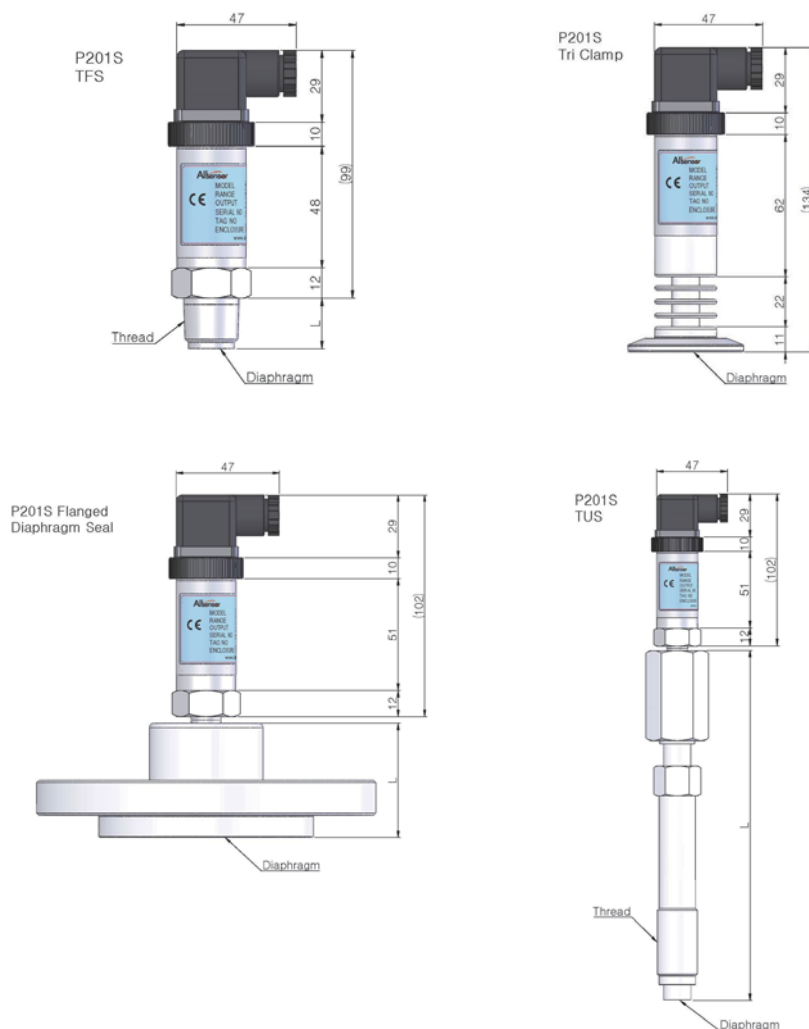

Dimension(mm)

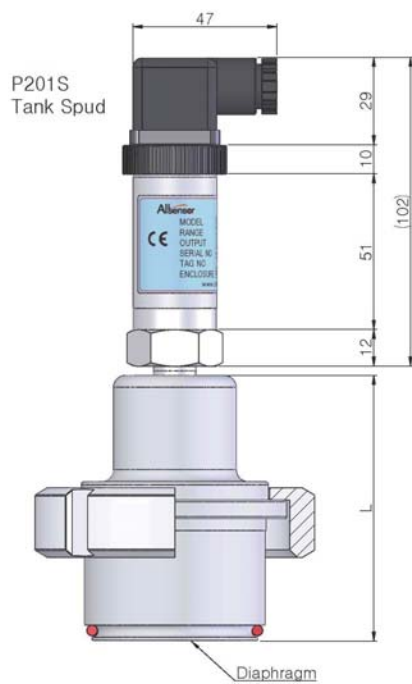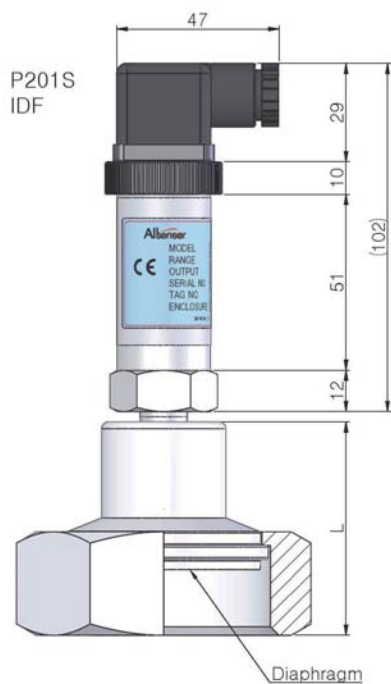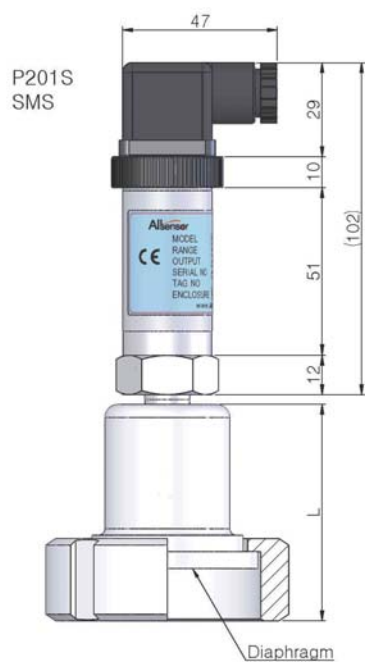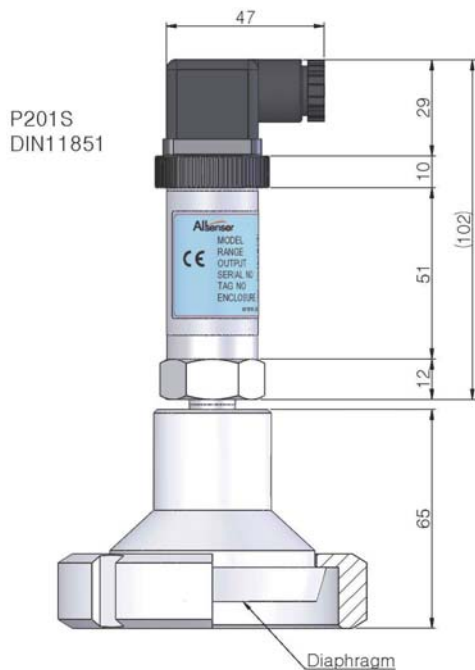

Dimension(mm)

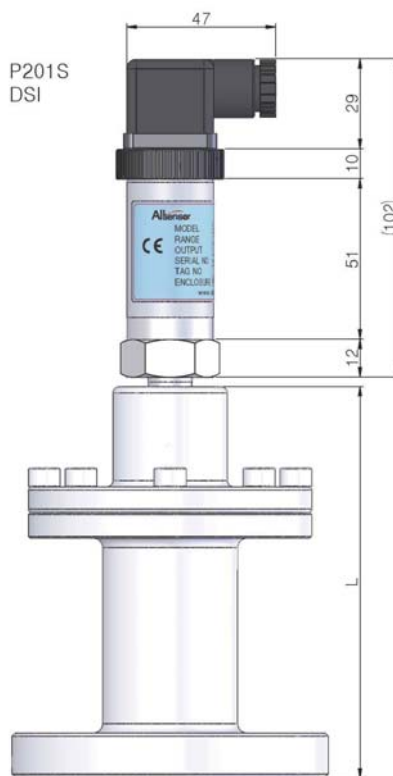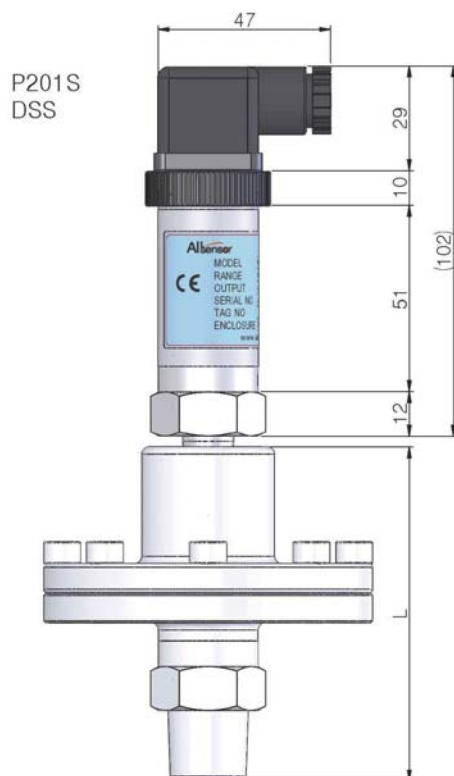

Ordering Information

P 2 0 1 S G H

Model Name

P201S :
Diaphragm Sealed
-Pressure Transmitter

Pressure Type

A : Absolute
G : Gauge

Out Put

H : 2Wire 4~20mA
E : 3Wire 1~5V

0 0 1 0 M

Pressure Range

Refer to pressure range code

Pressure Unit

M : MPa H : mmH₂O
B : bar G : mmHg
P : psi T : torr
K : kgf/cm²

P A D

Process Connection


A : PT 1/2" H : DSI
B : PT 3/4" I : IDF
C : PT 1" S : SMS
D : DIN 11851 T : Tri-Clamp
E : Extended U : Tank Spud
F : Flange O : Others
G : DSS

Electric Connection


D : DIN 43650
C : Cable
M : M12 Connector

Pressure Transducer & Transmitter


Installation and Wiring

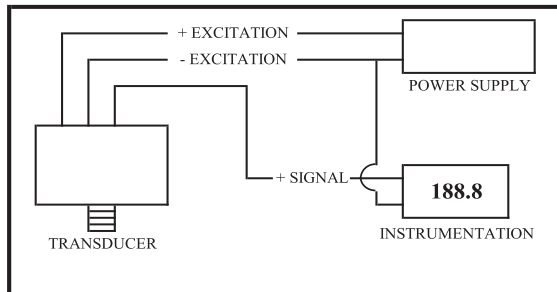


3Wire Configuration for voltage output Transducer
("+"Excitation and "-"Signal Are Common)

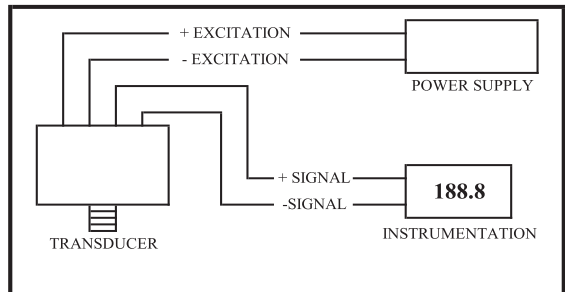


4Wire Configuration Millivolt Output Transducer

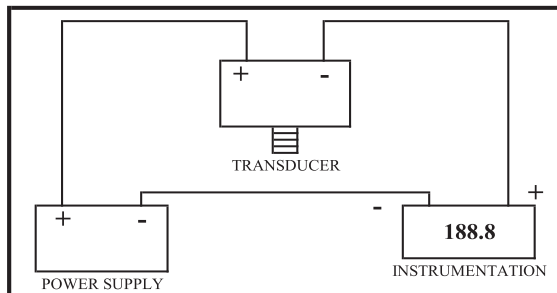


2Wire Configuration for Current output Transducer

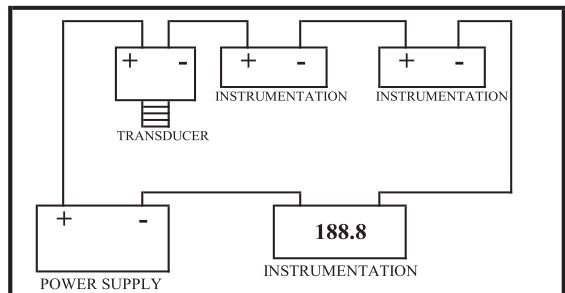


Multi-instrument 4-20mA Current Loop
(Panel Meters, Chart Recorder, Computers, etc)

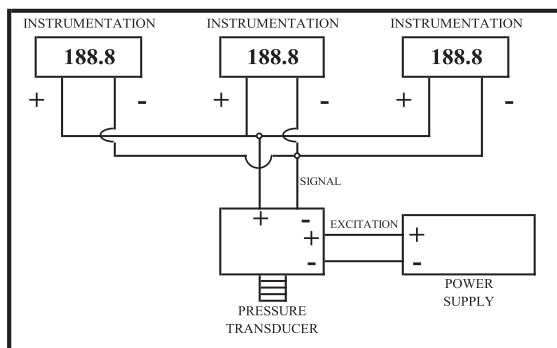

Multiple Instruments Wired In Parallel to a Voltage Output

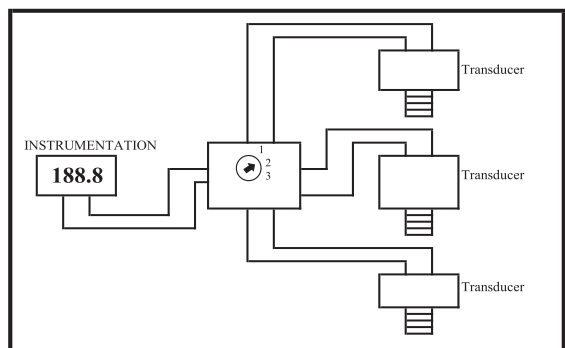

Multiple Transducer Wired to One Meter and One Switch
(Transducer With Built-in Zero & Span Adjustments, Same outputs & Same Pressure Range)

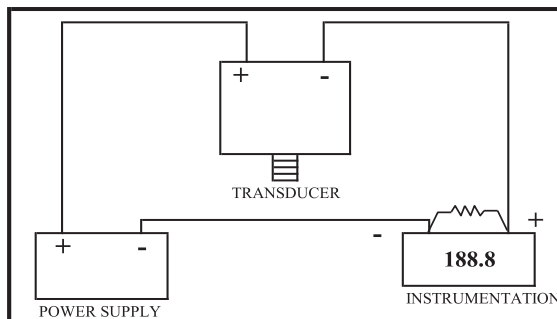

Converting Current Into Voltage For Instrumentation Set Up For Voltage